


MONUMENT RECORD

Corner ID: **CICr_C09**

Quarter Corner



Sections 07 & 18 T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

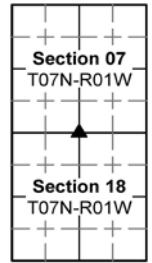

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)
1/2" rebar found 3" above grade

MONUMENT LOCATION SKETCH:

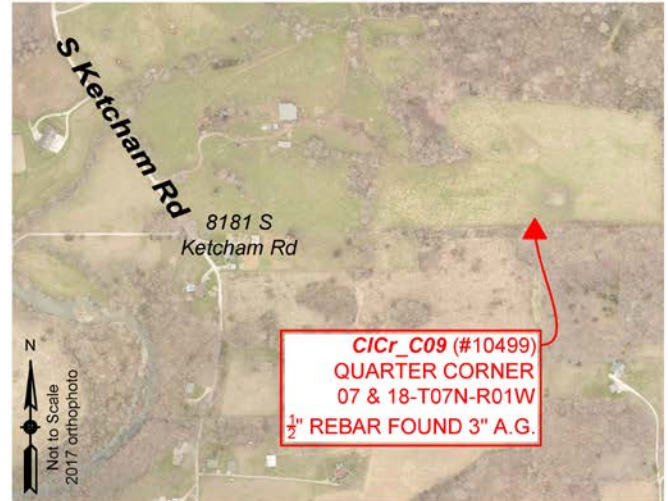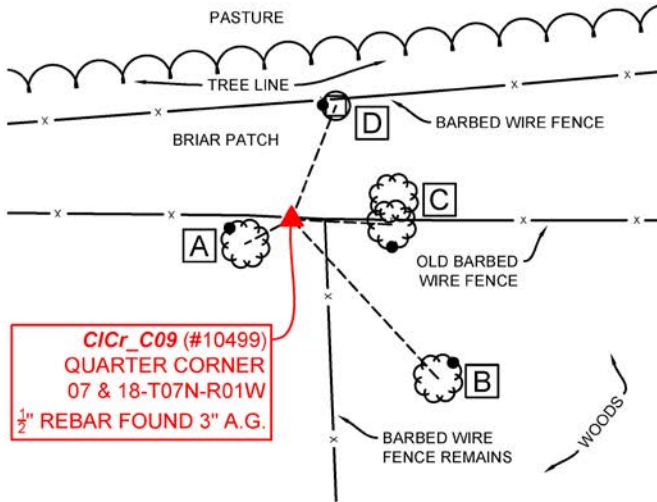

WITNESS MONUMENT TIES

All ties to new Bearing Trees (BTs) are a mag nail set in a 1-1/2" plastic washer stamped "SURVEY MARKER - DO NOT REMOVE" and hack mark at the root crown (less than 12" above ground) perpendicular to the center of the tree, unless otherwise noted. BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail.

ID	BEARING	DISTANCE	DESCRIPTION
Witness A	S 62d W	11.1'	Mag nail and washer set in hack 0.8' above grade in the northwest root of a 15" maple
Witness B	S 43d E	45.8'	Mag nail and washer set in hack 0.8' above grade in the northeast root of a 21" maple
Witness C	S 87d E	21.2'	Mag nail and washer set in hack 0.5' above grade in the south root of a double hackberry in 11" stalk, other stalk is 7"
Witness D	N 21d E	25.8'	Mag nail and washer set 0.5' above grade in the west side of a 0.6' x 0.6' RR tie fence post



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 1 of 3

MONUMENT RECORD

Corner ID: **CICr_C09**

Quarter Corner

Sections 07 & 18 T07N-R01W, 2nd P.M.
Clear Creek Township, Monroe County, Indiana

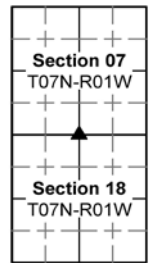


PHOTO IDENTIFIED: Photo Date: 5/1/2018



Photo Orientation & Description: CICr_C09 from above



Photo Orientation & Description: Looking north at CICr_C09



Photo Orientation & Description: Looking east at CICr_C09



Photo Orientation & Description: Looking south at CICr_C09

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND: Include, search area or areas, search procedure, etc.

Date of Field work/Search: 5/1/2018 By: RSO & CAR Monument Found: 1/2" rebar BTs or Reference Objects Found: None Project #: CICr_2018 Field Book: 52/4 Equipment: The basis of bearings is Grid North System NAD83(2011)/Indiana West NAVD 88, Epoch 2010.0000, geoid12b_conus.db3, US Survey Feet, derived from GPS observations utilizing a Javad Triumph LS Rover and a Javad Triumph 2 Base. Static observations were post-processed using the JAVAD GNSS Data Online Processing Service (DPOS). Coordinate data was collected with a Javad Triumph LS Rover or radially with a conventional total station (Sokkia Set 510) from points established by GPS. Distances to witness ties were collected with a Leica Disto laser distance meter. Bearings to witness ties were collected with the internal magnetic compass of the Javad Triumph LS and were automatically adjusted to grid north and are approximately shown hereon for reference. Priority should be given to provide distances over bearings. Notes: A 3" round wooden fence post was found with fence remains to the south and poor condition barbed wire fence to the east and west

OTHER EVIDENCE: Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.

The monument is in line with east/west barbed wire fence in poor condition. There is a pasture directly north of the monument and also a pasture to the west. A t-post was set 0.3' south of the monument.

MONUMENT PRESERVATION: Describe work done to preserve existing monument.

T-post set 0.3' south of rebar with a Monroe County "Protect Nearby Survey Marker" sign attached 2.4' above grade facing north. Took new ties and tied with orange flagging.



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us


Page 2 of 3

MONUMENT RECORD

Corner ID: **CICr_C09**

Quarter Corner

Sections 07 & 18 T07N-R01W, 2nd P.M.
Clear Creek Township, Monroe County, Indiana

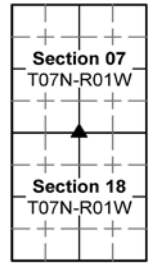

THEORY OF LOCATION: *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*
The 1/2" rebar was previously witnessed and the Monument Record prepared under the direction of the Monroe County Surveyor, Steven V. Farkas, on January 25, 1985. The 1985 Monument Record accepted the 1/2" rebar found 4" above grade.

CERTIFICATIONS:



Date:10/26/2020
Trohn Enright-Randolph
Monroe County Surveyor



Date:10/22/2020
Accepted by the Monroe
County Surveyor Review
Board



MONUMENT RECORD



STATE OF INDIANA - COUNTY OF MONROE

SECTION 18, TOWNSHIP 7 NORTH, RANGE 1 WEST

MONUMENT DESCRIPTION & REMARKS

FND. 1/2" REBAR 4" OUT OF GROUND, REBAR IS SOLID IN GROUND &
IN A FENCE ROW.

RECOVERY TIE DRAWING

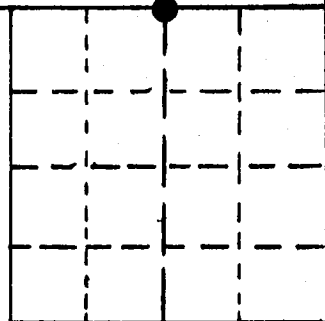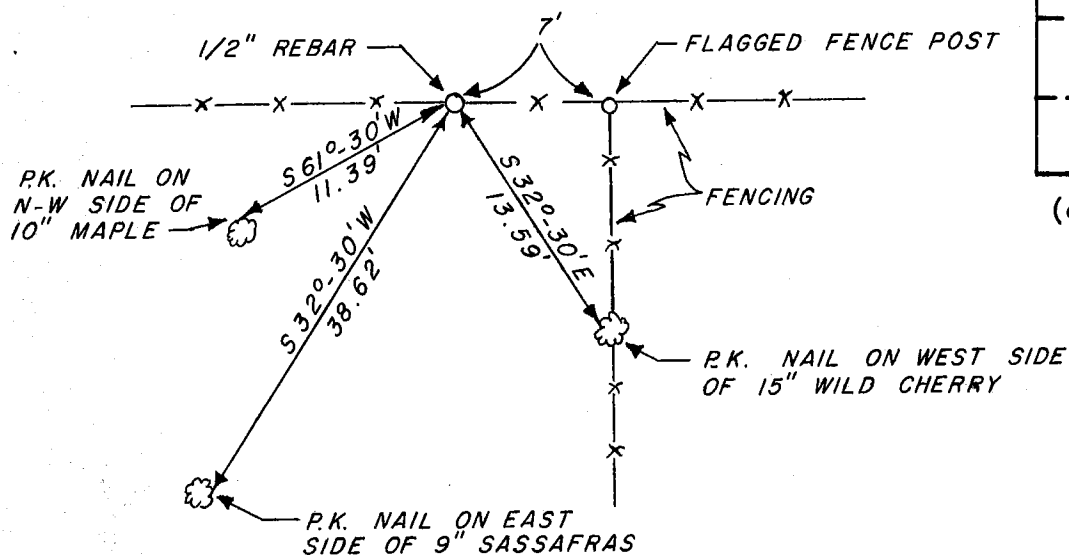

(●) AT CORNER



NOT TO SCALE

STATE OF INDIANA

COUNTY OF MONROE

I, EDMUND O. FARKAS HEREBY CERTIFY THAT THIS
DOCUMENT WAS PREPARED UNDER MY DIRECTION IN ACCORDANCE
WITH THE PROVISIONS OF SECTION 17-3-64-4 - 17-3-64-8 OF
THE INDIANA CODE, BEING ACTS OF 1965, CHAPTER 319; AND
THE ABOVE DATA IS GIVEN UNDER MY HAND AND SEAL
THIS 25TH DAY OF JANUARY, 1985 A.D.

SPACE
RESERVED
FOR
RECORDING
OFFICER.

INDIANA REGISTERED LAND SURVEYOR NO. _____

OR _____

UNITED STATES GOVERNMENT AGENCY

TITLE _____

TOWNSHIP:
CLEAR CREEK

CORNER I.D.

C-9